

















We Inspect, Maintain, Repair and Refurbish any manufacturers equipment

Operational Inspection

Thurston Parish Council

Thurst Coffee Shop Playground New Green Centre, New Green Ave, Thurston, IP31 3TG



Risk Assessment Matrix

			Scores in the report are multiplication factors of Likelihood x Severity					
				Severity>>				
Likelihood	Very High probability, if the situation is not addressed an accident is almost certain.	5	Very High	VL (5)	L (10)	M (15)	H (20)	VH (25)
	High probability an accident is probable without any added factor.	4	High	VL (4)	L (8)	M (12)	H (16)	H (20)
	Moderate probability an incident is foreseeable.	3	Moderate	VL (3)	L (6)	L (9)	M (12)	M (15)
	Some probability, requires a combination of factors to take place.	2	Low	VL (2)	VL (4)	L (6)	L (8)	L (10)
	No significant probability; lightning strike, freak accident.	1	Very Low	VL (1)	VL (2)	VL (3)	VL (4)	VL (5)
KOMPAN* Let's play				Very Low	Low	Moderate	High	Very High
				1	2	3	4	5
				No injury likely e.g. damaged or soiled clothing, minor bruising, grazes	Minor injury, laceration or bruising requiring first aid only	Injury requiring medical intervention e.g. cuts requiring stitches	Serious injury including concussions or fracture of long bones	Severe injury involving a potential life changing injury or fatality
				Severity>>				

Note 1: The total risk scores included within our reports are a multipication factor of the calculated Likelihood and Severity of each finding. Both Likelihood and Severity are given a number between 1 - 5 as shown on the matrix above and these two numbers are then multiplied together to give the total risk score that is shown against defects on the report. Total risk scores can be divided in both directions, i.e. a total risk score of 12 could be a Likelihood (3) x Severity (4) or Likelihood (4) x Severity (3).

Note 2: When we inspect we only see a snapshot of the current condition of the equipment. It is the operators responsibility to ensure that there is a continuing level of maintenance to keep the equipment in good working order and the site fit for use.





Thurst Coffee Shop Playground

Inspection Ref: 2557393 Site Ref: 105133

Operational Inspection - 6-December-2024 - 08:39 Inspector Dan Carr

Risk Assessment: 5 Very Low Risk





Kompan Ltd. Serenity House Shirwell Crescent Furzton Lake Milton Keynes MK4 1GA 01908 201002



5 - Very Low Risk

Item:Multi Play (Junior)Manufacturer:Kompan LtdSurface Type:Grass Matrix Tiles

Item Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -



4 - Very Low Risk

Item:Activity TrailManufacturer:Kompan LtdSurface Type:GrassItem Quantity:1Equipment Compliance:N/ASurface Area Compliance:N/A

Total Findings: 1



Finding 1

There is/are bolt cap covers missing or damaged on the item - Replace missing or damaged bolt cap covers



Kompan Ltd. Serenity House Shirwell Crescent Furzton Lake Milton Keynes MK4 1GA 01908 201002



🎧 5 - Very Low Risk

Item: Site General Manufacturer: Not Identified

Surface Type: Grass **Item Quantity:** 1 **Equipment Compliance:** N/A Surface Area Compliance: N/A

Total Findings: 1



Finding 1

This item is satisfactory - no work required -





Findings information



Item: Activity Equipment - Activity Trail

Manufacturer: Kompan Ltd

Risk Level: V - Very Low Risk Surface: Grass







Finding: There is/are bolt cap covers missing or damaged on the item

Action: Replace missing or damaged bolt cap covers



Kompan Ltd. Serenity House Shirwell Crescent Furzton Lake Milton Keynes MK4 1GA 01908 201002

Completed Findings InformationThe following items have been marked as complete by the inspector during the course of this inspection.



Activity Equipment - Activity Trail

Kompan Ltd Manufacturer:

Risk Level: L - Low Risk Surface: Grass







Finding: The item has missing component(s)

Action: Consider replacing missing components







6 - Low Risk (Finding 2) - Marked as complete on 6-December-2024

Item: Activity Equipment - Activity Trail

Manufacturer: Kompan Ltd



Finding: A number of inaccessible fixing(s) have worked loose

Risk Level: L - Low Risk Surface: Grass



Action: Secure all loose fixings